



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	154	Date:	9/22/2004	MeterBasin:	01_WR14
Observer ID:	B	Crew:	T-2	Dye Test Recommended:	N
Defect No:	2	Setup No:	2	Priority CCTV:	

House Number	Street Prefix:	Street Name:	Street Type:
6309		Fairlane	DR

Source Type:	05= Downspout	Location:	9=Yard-Side	Severity:
Sector:	2=Private	Drainage Area:	600	

Comments:

SMOKE TEST PHOTOS

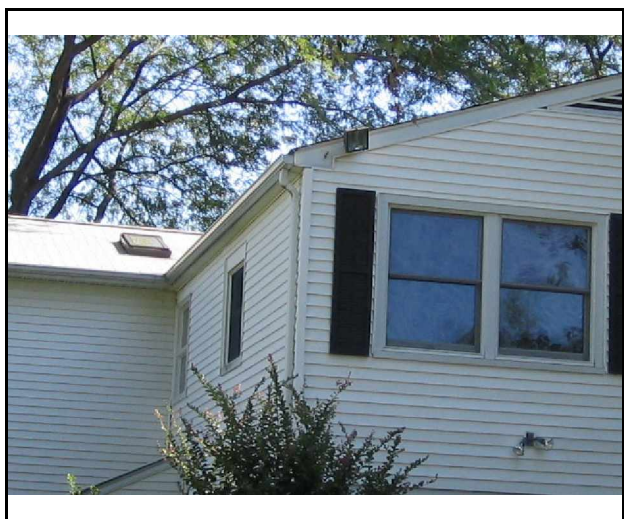


Photo No:

Filename Path:

Image Status: No image name specified.

Photo No: 51

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke
Testing\Pictures\0922-2004\T-2\PLAYER_B\B_2004_0922Image0051.JPG

Image Status: Image found and displayed.

Photo No:

Filename Path:

Image Status: No image name specified.

SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

FIELD SKETCH

**BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM**

Page 1 of 3
Smoke Set No. 22
Setup No. 2
154

TEST LOCATION			
Project: WRPA	Sewershed: Jones Falls	Date: 9/22/04	Start Time: 1030
Crew: T2	Street Location: Larryvale Road		
US MH: 1520949	DS MH: 1520678	Number of Segments: 7	Test Length: 1373'
Plugged US: Y (N)	Plugged DS: (Y) N	# of Blowers: 1 2 3	Ground: (Dry) Moderate Wet
Plugs Removed? (Y) N	Recorder: Bob Bink	Comments:	
FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)			

Did not get much smoke on Lincoln Ave until we tested from 1520679 (Possible Blockage). B2 drains to B1 (curb connection) & should not be considered a defect

Last Revised 9/16/2004

Leader Form

Sketch No: 154

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\154.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	154	Date:	9/22/2004	MeterBasin:	01_WR14
Observer ID:	B	Crew:	T-2	Dye Test Recommended:	N
Defect No:	3	Setup No:	2	Priority CCTV:	

House Number	Street Prefix:	Street Name:	Street Type:
6307		Fairlane	DR

Source Type:	04= Cleanout	Location:	7=Yard-Front	Severity:
Sector:	2=Private	Drainage Area:	0	

Comments:

SMOKE TEST PHOTOS



Photo No:

Filename Path:

Image Status: No image name specified.

Photo No: 52

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke
Testing\Pictures\0922-2004\T-2\PLAYER_B\B_2004_0922Image0052.JPG

Image Status: Image found and displayed.

Photo No:

Filename Path:

Image Status: No image name specified.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

FIELD SKETCH

Page 1 of 3
Smoke Set No. 22
Setup No. 2
154

**BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM**

TEST LOCATION			
Project: WRPA	Sewershed: Jones Falls	Date: 9/22/04	Start Time: 1030
Crew: T2	Street Location: Larryvale Road		
US MH: 1520949	DS MH: 1520678	Number of Segments: 7	Test Length: 1373'
Plugged US: Y (N)	Plugged DS: Y (N)	# of Blowers: 1 2 3	Ground: (Dry) Moderate Wet
Plugs Removed? Y (N)	Recorder: Bob Bink	Comments:	

FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	154	Date:	9/22/2004	MeterBasin:	01_WR14
Observer ID:	B	Crew:	T-2	Dye Test Recommended:	N
Defect No:	4	Setup No:	2	Priority CCTV:	

House Number	Street Prefix:	Street Name:	Street Type:
6303		Fairlane	DR

Source Type:	02= Service Line	Location:	5=Sidewalk	Severity:
Sector:	1=Public	Drainage Area:	40	

Comments:

SMOKE TEST PHOTOS



Photo No:

Filename Path:

Image Status: No image name specified.

Photo No: 53

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke
Testing\Pictures\0922-2004\T-2\PLAYER_B\B_2004_0922Image0053.JPG

Image Status: Image found and displayed.

Photo No:

Filename Path:

Image Status: No image name specified.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

FIELD SKETCH

Page 1 of 3
Smoke Set No. 22
Setup No. 2
154

**BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM**

TEST LOCATION			
Project: WRPA	Sewershed: Jones Falls	Date: 9/22/04	Start Time: 1030
Crew: T2	Street Location: Larryvale Road		
US MH: 1520949	DS MH: 1520678	Number of Segments: 7	Test Length: 1373'
Plugged US: Y (N)	Plugged DS: Y (N)	# of Blowers: 1 2 3	Ground: (Dry) Moderate Wet
Plugs Removed? Y (N)	Recorder: Bob Blank	Comments:	

FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)

CREW COMMENTS

Did not get much smoke on Lincoln Ave until we tested from 1520679 (Possible Blockage). B2 drains to B1 (curb connection) & should not be considered a defect

Last Revised 9/16/2004 Leader Form

Sketch No: 154

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\154.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	154	Date:	9/22/2004	MeterBasin:	01_WR14
Observer ID:	B	Crew:	T-2	Dye Test Recommended:	N
Defect No:	5	Setup No:	2	Priority CCTV:	

House Number	Street Prefix:	Street Name:	Street Type:
6301		Fairlane	DR

Source Type:	04= Cleanout	Location:	7=Yard-Front	Severity:
Sector:	2=Private	Drainage Area:	9	

Comments:

SMOKE TEST PHOTOS



Photo No:

Filename Path:

Image Status: No image name specified.

Photo No: 54

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke
Testing\Pictures\0922-2004\T-2\PLAYER_B\B_2004_0922Image0054.JPG

Image Status: Image found and displayed.

Photo No:

Filename Path:

Image Status: No image name specified.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

FIELD SKETCH

Page 1 of 3
Smoke Set No. 22
Setup No. 2
154

**BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM**

TEST LOCATION			
Project: WRPA	Sewershed: Jones Falls	Date: 9/22/04	Start Time: 1030
Crew: T2	Street Location: Larryvale Road		
US MH: 1520949	DS MH: 1520678	Number of Segments: 7	Test Length: 1373'
Plugged US: Y (N)	Plugged DS: Y (N)	# of Blowers: 1 2 3	Ground: (Dry) Moderate Wet
Plugs Removed? Y (N)	Recorder: Bob Blank	Comments:	

FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)

CREW COMMENTS

Did not get much smoke on Lincoln Ave until we tested from 1520679 (Possible blockage). B2 drains to B1 (curb connection) & should not be considered a defect

Last Revised 9/16/2004 Leader Form

Sketch No: 154

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\154.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	154	Date:	9/22/2004	MeterBasin:	01_WR14
Observer ID:	B	Crew:	T-2	Dye Test Recommended:	N
Defect No:	6	Setup No:	2	Priority CCTV:	

House Number	Street Prefix:	Street Name:	Street Type:
6300		Fairlane	DR

Source Type:	04= Cleanout	Location:	7=Yard-Front	Severity:
Sector:	2=Private	Drainage Area:	0	

Comments:

SMOKE TEST PHOTOS



Photo No:

Filename Path:

Image Status: No image name specified.

Photo No: 55

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke
Testing\Pictures\0922-2004\T-2\PLAYER_B\B_2004_0922Image0055.JPG

Image Status: Image found and displayed.

Photo No:

Filename Path:

Image Status: No image name specified.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

FIELD SKETCH

Page 1 of 3
Smoke Set No. 22
Setup No. 2
154

**BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM**

TEST LOCATION			
Project: WRPA	Sewershed: Jones Falls	Date: 9/22/04	Start Time: 1030
Crew: T2	Street Location: Larryvale Road		
US MH: 1520949	DS MH: 1520678	Number of Segments: 7	Test Length: 1373'
Plugged US: Y (N)	Plugged DS: Y (N)	# of Blowers: 1 2 3	Ground: (Dry) Moderate Wet
Plugs Removed? Y (N)	Recorder: Bob Bink	Comments:	

FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)

CREW COMMENTS

Did not get much smoke on Lincoln Ave until we tested from 1520679 (Possible Blockage). B2 drains to B1 (curb connection) & should not be considered a defect

Last Revised 9/16/2004 Leader Form

Sketch No: 154

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\154.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	154	Date:	9/22/2004	MeterBasin:	01_WR14
Observer ID:	B	Crew:	T-2	Dye Test Recommended:	N
Defect No:	7	Setup No:	2	Priority CCTV:	

House Number	Street Prefix:	Street Name:	Street Type:
2504		Larryvale	ROAD

Source Type:	05= Downspout	Location:	7=Yard-Front	Severity:
Sector:	2=Private	Drainage Area:	200	

Comments:

SMOKE TEST PHOTOS



Photo No:

Filename Path:

Image Status: No image name specified.

Photo No: 56

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke
Testing\Pictures\0922-2004\T-2\PLAYER_B\B_2004_0922Image0056.JPG

Image Status: Image found and displayed.

Photo No:

Filename Path:

Image Status: No image name specified.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

FIELD SKETCH

Page 1 of 3
Smoke Set No. 22
Setup No. 2
154

**BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM**

TEST LOCATION			
Project: WRPA	Sewershed: Jones Falls	Date: 9/22/04	Start Time: 1030
Crew: T2	Street Location: Larryvale Road		
US MH: 1520949	DS MH: 1520678	Number of Segments: 7	Test Length: 1373'
Plugged US: Y (N)	Plugged DS: Y (N)	# of Blowers: 1 2 3	Ground: (Dry) Moderate Wet
Plugs Removed? Y (N)	Recorder: Bob Blank	Comments:	

FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	154	Date:	9/22/2004	MeterBasin:	01_WR14
Observer ID:	B	Crew:	T-2	Dye Test Recommended:	N
Defect No:	8	Setup No:	2	Priority CCTV:	

House Number	Street Prefix:	Street Name:	Street Type:
6307		Shelrick	DR

Source Type:	04= Cleanout	Location:	7=Yard-Front	Severity:
Sector:	2=Private	Drainage Area:	25	

Comments:

SMOKE TEST PHOTOS



Photo No:

Filename Path:

Image Status: No image name specified.

Photo No: 57

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke
Testing\Pictures\0922-2004\T-2\PLAYER_B\B_2004_0922Image0057.JPG

Image Status: Image found and displayed.

Photo No:

Filename Path:

Image Status: No image name specified.

SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

FIELD SKETCH

Page 1 of 3
Smoke Set No. 22
Setup No. 2
154

BUREAU OF WATER AND WASTEWATER SMOKE TEST INSPECTION FORM

TEST LOCATION				
Project: WRPA	Sewershed: Jones Falls	Date: 9/22/04	Start Time: 1030	
Crew: T2	Street Location: Larryville Rd			
US MH: 1520949	DS MH: 1520678	Number of Segments: 7	Test Length: 1373'	
Plugged US: Y (N)	Plugged DS: Y N	# of Blowers 1 2 3	Ground: Dry Moderate Wet	
Plugs Removed? Y N	Recorder: Bob Blank	Comments:		

FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)

CREW COMMENTS

Did not get much smoke on Lincoln Ave until we tested from 1520679 (Possible Blockage). B2 drains to B1 (curb connection) + should not be considered a defect.

Last Revised 9/16/2004

Leader Form

Sketch No:

154

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\154.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	154	Date:	9/22/2004	MeterBasin:	01_WR14
Observer ID:	B	Crew:	T-2	Dye Test Recommended:	N
Defect No:	9	Setup No:	2	Priority CCTV:	

House Number	Street Prefix:	Street Name:	Street Type:
2506		Larryvale	ROAD

Source Type:	04= Cleanout	Location:	7=Yard-Front	Severity:
Sector:	2=Private	Drainage Area:	0	

Comments:

SMOKE TEST PHOTOS



Photo No:

Filename Path:

Image Status: No image name specified.

Photo No: 58

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke
Testing\Pictures\0922-2004\T-2\PLAYER_B\B_2004_0922Image0058.JPG

Image Status: Image found and displayed.

Photo No:

Filename Path:

Image Status: No image name specified.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

FIELD SKETCH

Page 1 of 3
Smoke Set No. 22
Setup No. 2
154

**BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM**

TEST LOCATION			
Project: WRPA	Sewershed: Jones Falls	Date: 9/22/04	Start Time: 1030
Crew: T2	Street Location: Larryvale Road		
US MH: 1520949	DS MH: 1520678	Number of Segments: 7	Test Length: 1373'
Plugged US: Y (N)	Plugged DS: Y (N)	# of Blowers: 1 2 3	Ground: (Dry) Moderate Wet
Plugs Removed? Y (N)	Recorder: Bob Blank	Comments:	

FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)

CREW COMMENTS

Did not get much smoke on Lincoln Ave until we tested from 1520679 (Possible Blockage). B2 drains to B1 (curb connection) & should not be considered a defect

Last Revised 9/16/2004 Leader Form

Sketch No: 154

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\154.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	155	Date:	9/22/2004	MeterBasin:	
Observer ID:	B	Crew:	T-2	Dye Test Recommended:	N
Defect No:	1	Setup No:	3	Priority CCTV:	

House Number	Street Prefix:	Street Name:	Street Type:
2507		Green Meadow	PKWY

Source Type:	04= Cleanout	Location:	7=Yard-Front	Severity:
Sector:	2=Private	Drainage Area:	0	

Comments:

SMOKE TEST PHOTOS



Photo No:

Filename Path:

Image Status: No image name specified.

Photo No: 70

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke
Testing\Pictures\0922-2004\T-2\PLAYER_B\B_2004_0922Image0070.JPG

Image Status: Image found and displayed.

Photo No:

Filename Path:

Image Status: No image name specified.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

FIELD SKETCH

Page 1 of 2
Smoke Set No. 22
Setup No. 3
155

**BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM**

TEST LOCATION			
Project: WRPA	Sewershed: Jones Falls	Date: 9/22/04	Start Time: 1430
Crew: T2	Street Location: Green Meadow Pkwy		
US MH: 1520792	OS MH: 1520675	Number of Segments: 10	Test Length: 1182'
Plugged US: <input checked="" type="radio"/> Y <input type="radio"/> N	Plugged DS: <input checked="" type="radio"/> Y <input type="radio"/> N	# of Blowers: 1(2)3	Ground: <input checked="" type="radio"/> Dry Moderate Wet
Plugs Removed? <input checked="" type="radio"/> Y <input type="radio"/> N	Recorder: Bob Bink	Comments:	

FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)

CREW COMMENTS

Last Revised 9/16/2004Leader Form

Sketch No:

155

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\155.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	155	Date:	9/22/2004	MeterBasin:	
Observer ID:	B	Crew:	T-2	Dye Test Recommended:	N
Defect No:	2	Setup No:	3	Priority CCTV:	

House Number	Street Prefix:	Street Name:	Street Type:
2507		Green Meadow	PKWY

Source Type:	02= Service Line	Location:	7=Yard-Front	Severity:
Sector:	2=Private	Drainage Area:	9	

Comments:

SMOKE TEST PHOTOS



Photo No:

Filename Path:

Image Status: No image name specified.

Photo No: 71

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke
Testing\Pictures\0922-2004\T-2\PLAYER_B\B_2004_0922Image0071.JPG

Image Status: Image found and displayed.

Photo No:

Filename Path:

Image Status: No image name specified.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

FIELD SKETCH

Page 1 of 2
Smoke Set No. 22
Setup No. 3
155

**BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM**

TEST LOCATION			
Project: WRPA	Sewershed: Jones Falls	Date: 9/22/04	Start Time: 1430
Crew: T2	Street Location: Green Meadow Pkwy		
US MH: 1520792	OS MH: 1520675	Number of Segments: 10	Test Length: 1182'
Plugged US: <input checked="" type="radio"/> Y <input type="radio"/> N	Plugged DS: <input checked="" type="radio"/> Y <input type="radio"/> N	# of Blowers: 1(2)3	Ground: <input checked="" type="radio"/> Dry Moderate Wet
Plugs Removed? <input checked="" type="radio"/> Y <input type="radio"/> N	Recorder: Bob Bink	Comments:	

FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)

CREW COMMENTS

Last Revised 9/16/2004Leader Form

Sketch No:

155

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\155.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	155	Date:	9/22/2004	MeterBasin:	
Observer ID:	B	Crew:	T-2	Dye Test Recommended:	N
Defect No:	3	Setup No:	3	Priority CCTV:	

House Number	Street Prefix:	Street Name:	Street Type:
2407		Green Meadow	PKWY

Source Type:	04= Cleanout	Location:	7=Yard-Front	Severity:
Sector:	2=Private	Drainage Area:	0	

Comments:

SMOKE TEST PHOTOS



Photo No:

Filename Path:

Image Status: No image name specified.

Photo No: 72

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke
Testing\Pictures\0922-2004\T-2\PLAYER_B\B_2004_0922Image0072.JPG

Image Status: Image found and displayed.

Photo No:

Filename Path:

Image Status: No image name specified.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

FIELD SKETCH

Page 1 of 2
Smoke Set No. 22
Setup No. 3
155

**BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM**

TEST LOCATION			
Project: WRPA	Sewershed: Jones Falls	Date: 9/22/04	Start Time: 1430
Crew: T2	Street Location: Green Meadow Pkwy		
US MH: 1520792	OS MH: 1520675	Number of Segments: 10	Test Length: 1182'
Plugged US: <input checked="" type="radio"/> Y <input type="radio"/> N	Plugged DS: <input checked="" type="radio"/> Y <input type="radio"/> N	# of Blowers: 1(2)3	Ground: <input checked="" type="radio"/> Dry Moderate Wet
Plugs Removed? <input checked="" type="radio"/> Y <input type="radio"/> N	Recorder: Bob Bink	Comments:	

FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)

Sketch No: 155

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\155.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	156	Date:	9/22/2004	MeterBasin:	
Observer ID:	B	Crew:	T-2	Dye Test Recommended:	N
Defect No:	1	Setup No:	4	Priority CCTV:	

House Number	Street Prefix:	Street Name:	Street Type:
3318		Clarks	LANE

Source Type:	04= Cleanout	Location:	9=Yard-Side	Severity:
Sector:	2=Private	Drainage Area:	0	

Comments:

SMOKE TEST PHOTOS



Photo No:

Filename Path:

Image Status: No image name specified.

Photo No: 73

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke
Testing\Pictures\0922-2004\T-2\PLAYER_B\B_2004_0922Image0073.JPG

Image Status: Image found and displayed.

Photo No:

Filename Path:

Image Status: No image name specified.




SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland


FIELD SKETCH

Page 1 of 2
Smoke Set No. 23
Setup No. 4
156

**BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM**

TEST LOCATION			
Project: WRPA	Sewershed: Jones Falls	Date: 9/22/04	Start Time: 1600
Crew: T2	Street Location: Clarks Lane		
US MH: 1521291A	DS MH: 1521287	Number of Segments: 5	Test Length: 943'
Plugged US: Y N	Plugged DS: Y N	# of Blowers: 1 2 3	Ground: Dry Moderate Wet
Plugs Removed? Y N	Recorder: Bob Bunt	Comments:	

FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)

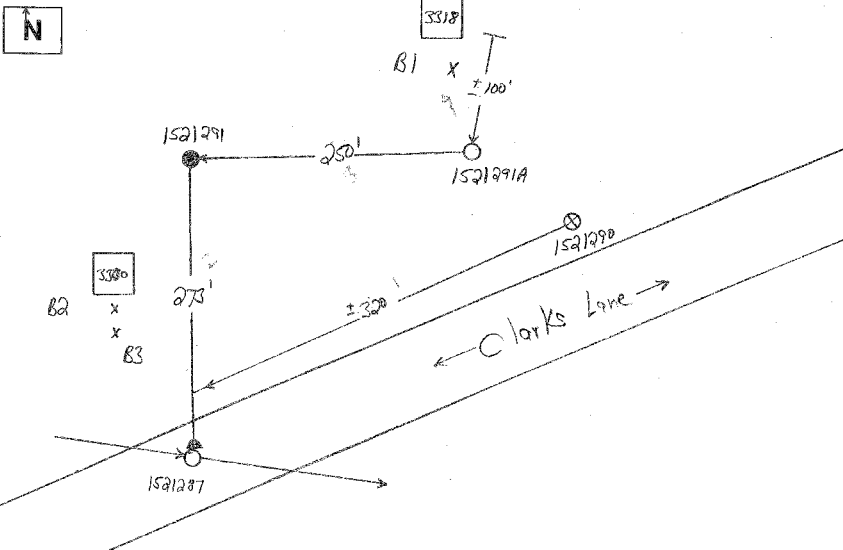

CREW COMMENTS

CNF 1521290. 1521291A not shown on map

Last Revised 9/16/2004 Leader Form

Sketch No: 156

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\156.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	156	Date:	9/22/2004	MeterBasin:	
Observer ID:	B	Crew:	T-2	Dye Test Recommended:	N
Defect No:	2	Setup No:	4	Priority CCTV:	

House Number	Street Prefix:	Street Name:	Street Type:
3330		Clarks	LANE

Source Type:	04= Cleanout	Location:	9=Yard-Side	Severity:
Sector:	2=Private	Drainage Area:	0	

Comments:

SMOKE TEST PHOTOS



Photo No:
Filename Path:

Image Status: No image name specified.

Photo No: 74

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke
Testing\Pictures\0922-2004\T-2\PLAYER_B\B_2004_0922Image0074.JPG

Image Status: Image found and displayed.

Photo No:
Filename Path:

Image Status: No image name specified.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

FIELD SKETCH

Page 1 of 2
Smoke Set No. 23
Setup No. 4
156

**BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM**

TEST LOCATION			
Project: WRPA	Sewershed: Jones Falls	Date: 9/22/04	Start Time: 1600
Crew: T2	Street Location: Clark's Lane		
US MH: 1521291A	DS MH: 1521287	Number of Segments: 5	Test Length: 943'
Plugged US: Y <input checked="" type="radio"/> N <input type="radio"/>	Plugged DS: Y <input checked="" type="radio"/> N <input type="radio"/>	# of Blowers: 1 2 3	Ground: Dry <input checked="" type="radio"/> Moderate <input type="radio"/> Wet <input type="radio"/>
Plugs Removed? Y <input checked="" type="radio"/> N <input type="radio"/>	Recorder: Bob Bunt	Comments:	

FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)

CREW COMMENTS

CNF 1521290. 1521291A not shown on map

Last Revised 9/16/2004 Leader Form

Sketch No: 156

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\156.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	156	Date:	9/22/2004	MeterBasin:	
Observer ID:	B	Crew:	T-2	Dye Test Recommended:	N
Defect No:	3	Setup No:	4	Priority CCTV:	

House Number	Street Prefix:	Street Name:	Street Type:
3330		Clarks	LANE

Source Type:	04= Cleanout	Location:	9=Yard-Side	Severity:
Sector:	2=Private	Drainage Area:	0	

Comments:

SMOKE TEST PHOTOS



Photo No:

Filename Path:

Image Status: No image name specified.

Photo No: 75

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke
Testing\Pictures\0922-2004\T-2\PLAYER_B\B_2004_0922Image0075.JPG

Image Status: Image found and displayed.

Photo No:

Filename Path:

Image Status: No image name specified.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

FIELD SKETCH

Page 1 of 2
Smoke Set No. 23
Setup No. 4
156

**BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM**

TEST LOCATION			
Project: WRPA	Sewershed: Jones Falls	Date: 9/22/04	Start Time: 1600
Crew: T2	Street Location: Clark's Lane		
US MH: 1521291A	DS MH: 1521287	Number of Segments: 5	Test Length: 943'
Plugged US: Y N	Plugged DS: Y N	# of Blowers: 1 2 3	Ground: Dry Moderate Wet
Plugs Removed? Y N	Recorder: Bob Bunt	Comments:	

FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)

CREW COMMENTS

CNF 1521290. 1521291A not shown on map

Last Revised 9/16/2004 Leader Form

Sketch No: 156

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\156.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

Unique Test ID	157	Date:	9/22/2004	MeterBasin:	
Observer ID:	B	Crew:	T-2	Dye Test Recommended:	N
Defect No:	1	Setup No:	5	Priority CCTV:	

House Number	Street Prefix:	Street Name:	Street Type:
3335		Clarks	LANE

Source Type:	02= Service Line	Location:	8=Yard-Back	Severity:
Sector:	2=Private	Drainage Area:	32	

Comments:

SMOKE TEST PHOTOS



Photo No:

Filename Path:

Image Status: No image name specified.

Photo No: 76

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke
Testing\Pictures\0922-2004\T-2\PLAYER_B\B_2004_0922Image0076.JPG

Image Status: Image found and displayed.

Photo No:

Filename Path:

Image Status: No image name specified.



SMOKE TESTING OBSERVATION SUMMARY

Western Run Pilot Project - Baltimore Maryland

FIELD SKETCH

Page 1 of 2
Smoke Set No. 23
Setup No. 5
157

**BUREAU OF WATER AND WASTEWATER
SMOKE TEST INSPECTION FORM**

TEST LOCATION			
Project: WRPA	Sewershed: Jones Falls	Date: 9/22/04	Start Time: 1730
Crew: T2	Street Location: Chicks Lane		
US MH: 1521289	DS MH: 1522369	Number of Segments: 5	Test Length: 1176'
Plugged US: Y <input checked="" type="radio"/> N <input type="radio"/>	Plugged DS: Y <input checked="" type="radio"/> N <input type="radio"/>	# of Blowers: 1 2 3	Ground: <input checked="" type="radio"/> Dry Moderate Wet
Plugs Removed? <input checked="" type="radio"/> Y <input type="radio"/> N	Recorder: Bob Brink	Comments:	

FIELD SKETCH (Show manholes and ID numbers, blower placement, source defect number, bldgs & street addresses, sandbag locations, etc.)

CREW COMMENTS

1521287A not shown on map.

Last Revised 9/16/2004Leader Form

Sketch No: 157

Filename Path:

X:\Baltimore City\Western Run Pilot Area - Data Files\Smoke Testing\Pictures\Sketches\157.tif

Image Status: Image found and displayed.

NOTE: Sanitary sewer alignments and connectivity in the Western Run GIS have been revised following smoke testing to reflect updated information from various sources and may no longer match the field sketches shown.